


# City of Wichita, Kansas

## Americans with Disabilities Act Transition Plan

# Heritage Square Park

115 East William

**July 2005**

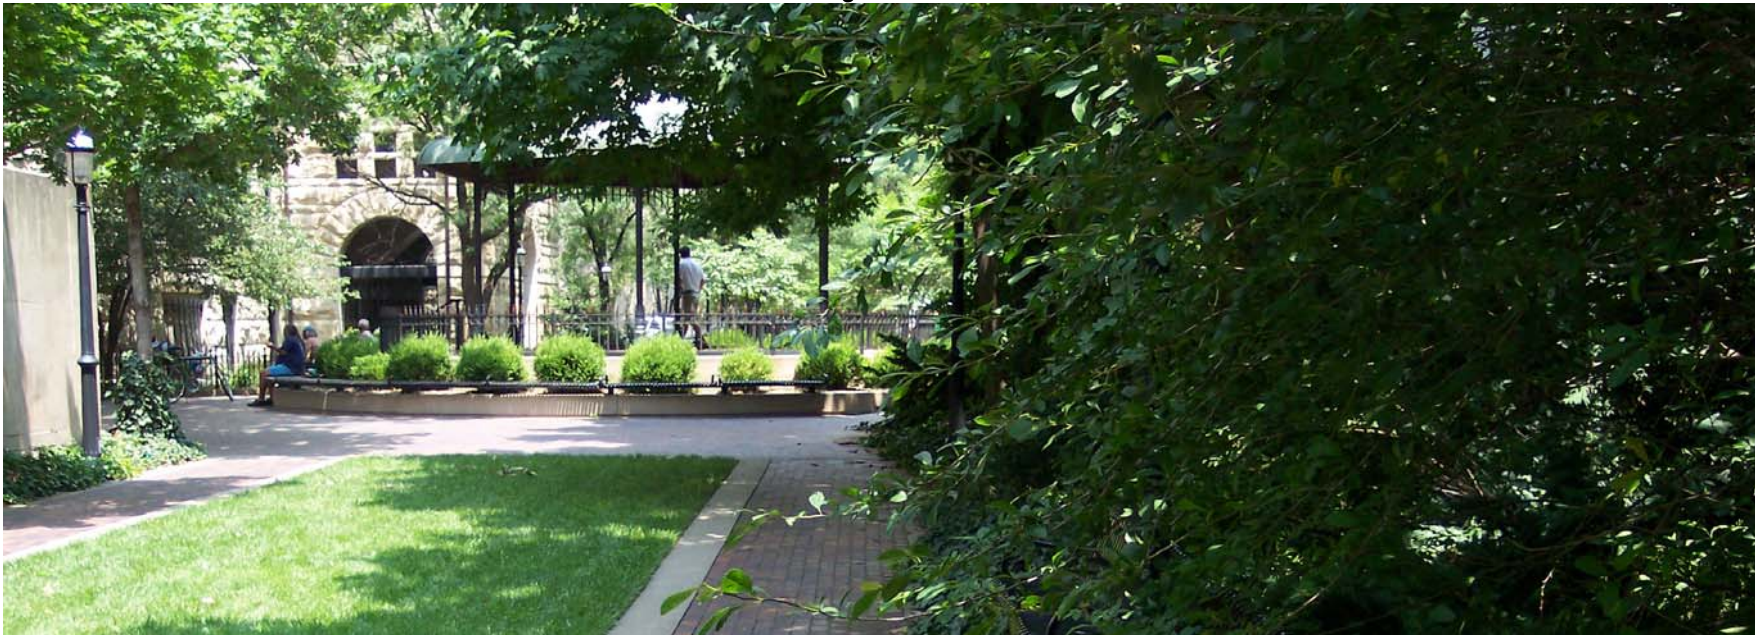

Prepared by

**DMCG**

**Disability Management Consulting Group L.L.C.**

2801 Jonquil Place  
Columbia, MO 65202

In conjunction with

**The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board**

---

## City of Wichita – ADA/504 Transition Plan – Heritage Square Park - July 2005

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies	Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Pedestrian Paths	Tree branches protrude into the accessible path of travel.	<a href="#">4.4</a>	Where objects protrude into an accessible path more than 4-inches and their leading edge is higher than 27-inches, these objects are considered protruding objects, which may not be detectable by individuals who are blind and use a cane. <b>Trim branches so they are not protruding into the path of travel.</b>	L ® H	H	M	<a href="#">1</a>	\$50	<a href="#">Building Block 2 – 27” to 80” zone</a>			
2. Pedestrian Paths	The path of travel leading to the Gazebo has a slope steeper than 5% and does not provide handrails on each side.	<a href="#">4.8</a>	ADAAG specifies that accessible routes with running slopes greater than 5% provide handrails on each side. <b>Provide handrails on both sides of the path of travel where the surface running slope measures over 5%.</b>	M ®	H	M	<a href="#">2</a> <a href="#">3</a>	\$500	<a href="#">Ramp Detail</a>			
3. Pedestrian Paths	The path of travel leading to the drinking fountain has a slope steeper than 5% and does not provide handrails on each side.	<a href="#">4.8</a>	ADAAG specifies that accessible routes with running slopes greater than 5% provide handrails on each side. <b>Provide handrails on both sides of the path of travel where the surface running slope measures over 5%.</b>	M ®	H	M	<a href="#">5</a> <a href="#">6</a>	\$500	<a href="#">Ramp Detail</a>			
4. Pedestrian Paths	The faucet control, on the drinking fountain, is not within specified reach range.	<a href="#">4.15</a> <a href="#">4.1.3(10)</a>	According to ADAAG, the number of all facilities and elements, which are required to be accessible, are delineated in ADAAG section <a href="#">4.1</a> . However, 4.1 only addresses drinking fountains in reference to floors of a building or facility. The program access provisions of <a href="#">Title II</a> require all programs and services to be accessible and usable. Drinking fountains are a service provided by the City and must be made accessible. The number of drinking fountains that are required to be accessible in a park or play area setting is debatable, but we consider that at least one at this particular park should be fully accessible to individuals who use wheelchairs. <b>Modify the existing drinking fountain to comply with ADAAG specifications for individuals who use wheelchairs, including spout height. Additionally, we recommend providing a hi-lo fountain where the existing fountain is located.</b>	L M	M	M	<a href="#">4</a>	\$300	<a href="#">Building Block 7 – Drinking Fountains</a>  <a href="#">Sample hi-lo fountain in park setting</a>			

**Heritage Square Park - Conceptual Cost Projections**

Total	<i>\$1,350</i>
Year One (Very High)	<b>\$0</b>
Year Three (High)	<b>\$50</b>
Year Five (Medium)	<b>\$1,300</b>
Year Ten (Low)	<b>\$0</b>